

# Aisin AW TR-60SN\*

\*Also fits VW/Audi 09D

# sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA  
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

## 1 25741-29K Lockup Clutch Control Valve Kit



*Helps cure:*

- Converter remains applied causing harsh downshifts/RPM surge on coast
- Fluid overheat
- TCC issues

**Note:** Requires tool kit F-25741-TL29 & the VB-FIX reaming fixture.

## 2 25741-34K Lockup Clutch Control Plunger Valve Kit

*Helps cure:*


- TCC apply & release complaints
- TCC codes
- Surge on coast & light acceleration

## 3 25741-36K Secondary Pressure Regulator Boost Valve Kit

*Helps cure:*

- Excessive TCC slip
- TCC surge
- Bushing failures

## 4 25741-01K Oversized Pressure Regulator Valve Kit

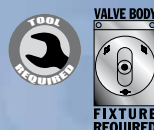

*Helps cure:*

- Excess pressure in reverse
- Fluid & converter overheat
- Bushing failure

**Note:** Requires tool kit F-25741-TL & the VB-FIX reaming fixture.


## 5 25741-11K Secondary Pressure Regulator Valve Kit



*Helps cure:*


- High/Low SLT pressure
- Overheating bushings & converter
- Harsh reverse

**Note:** Requires tool kit F-25741-TL11 & the VB-FIX reaming fixture.

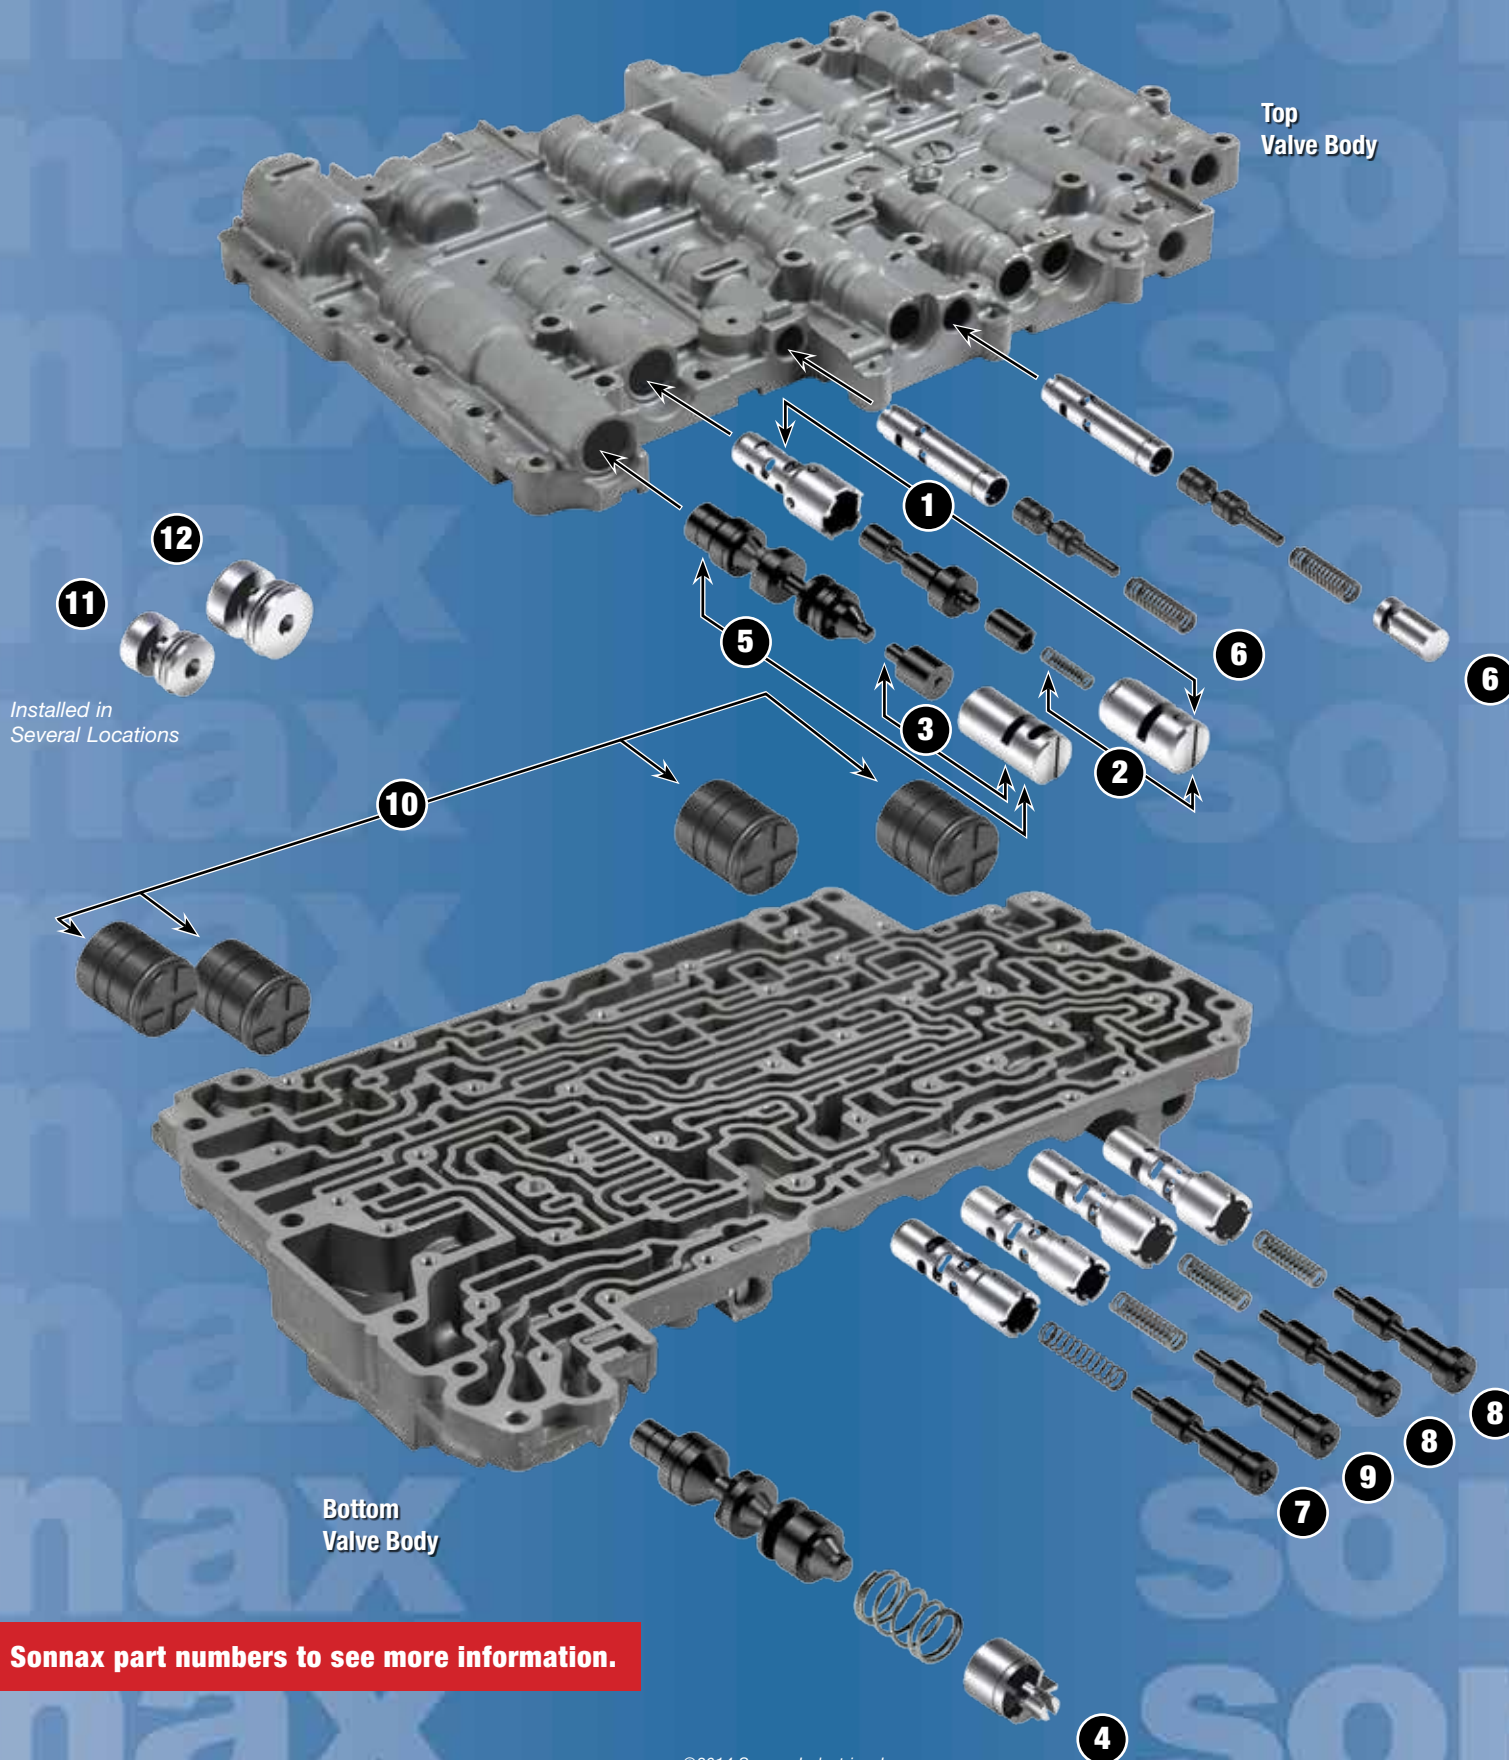

Click on Sonnax part numbers to see more information.

## 6 25741-18K Solenoid Modulator Valve Kit

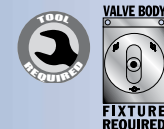


*Helps cure:*

- Linear solenoid and/or gear ratio codes
- Slippage/Shock on kickdown
- Slippage in steady driving 4, 5 or 6th gear

**Note:** Requires tool kit F-25741-TL18 & the VB-FIX reaming fixture.

## 7 25741-25K K1 Clutch Control Valve Kit

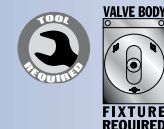

*Helps cure:*

- Flare upshifts/harsh coast downshifts
- Delayed engagement

**Note:** Requires tool kit F-25741-TL25 & the VB-FIX reaming fixture.

## 8 25741-05K K2 Clutch/B1 Brake Control Valve Kit



Fits either of 2 locations

*Helps cure:*

- Flare upshifts/harsh coast downshifts
- Delayed engagement

**Note:** Requires tool kit F-25741-TL5 & the VB-FIX reaming fixture.

## 9 25741-08K K3 Clutch Control Valve Kit



*Helps cure:*

- Flare upshifts/harsh coast downshifts
- Delayed engagement

**Note:** Requires tool kit F-25741-TL8 & the VB-FIX reaming fixture.

## 10 15741-14K Fits any of 4 locations Accumulator Piston Kit

*Helps cure:*

- Delayed engagements
- Slipping forward gears
- Burnt bands/clutches

## 11 15741-35K 5 Small, 9mm

## 12 15741-36K 5 Large, 11mm

### O-Ringed End Plug Kits

*Helps cure:*

- Various shift complaints