

# Ford 5R55N

# sonnax®

TIME TESTED • INDUSTRY TRUSTED®


1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA  
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

**1 56947J-05K\***  
**Oversized TCC Control Valve Kit**

*Helps cure:*

- Excess TCC slip, Code 741
- TCC lining comes off

**Note:** Requires tool kit F-56947J-TL2, & the VB-FIX reaming fixture.

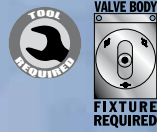


**2 56947J-15K\***  
**Oversized TCC Modulator Valve & Sleeve Kit**

*Helps cure:*

- Excess TCC slip, Codes 741 & 1783
- Transmission over temperature

**Note:** Requires tool kit F-56947J-TL15 & the VB-FIX reaming fixture.

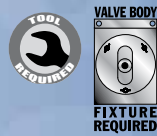

**3 56947J-32K**  
**TCC Modulator Sleeve & Plunger Valve Kit**

*Helps cure:*


- High TCC slip RPM at increasing load
- Slip codes, Elevated fluid temperature

**4 56947J-63K**  
**Oversized Converter Clutch Back Pressure Valve Kit**


*Helps cure:*

- Converter burn-up or apply complaints
- Delayed engagements

**Note:** Requires tool kit F-56947J-TL63 & the VB-FIX reaming fixture.

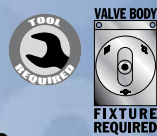

\*These parts also fit 5R55W/S units.

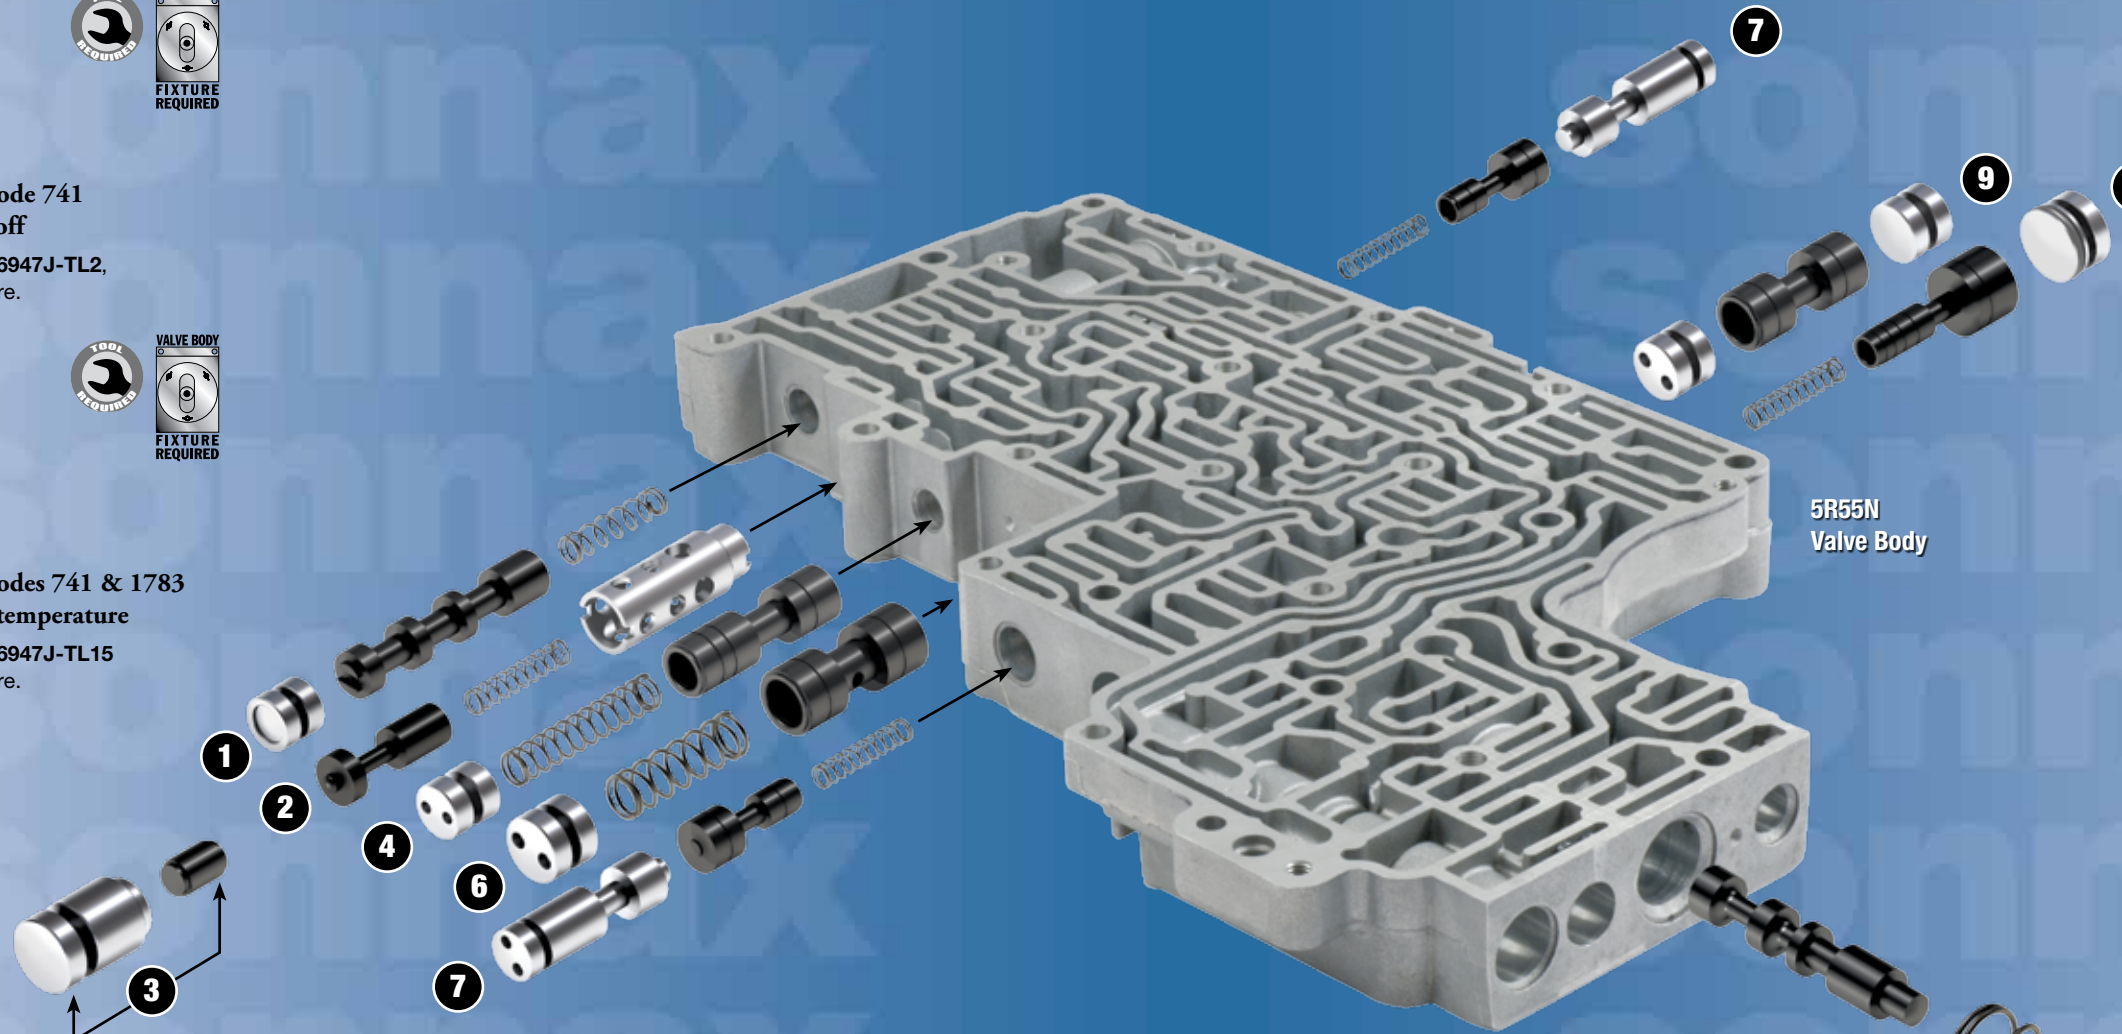


**5 56947J-39K**  
**Oversized Pressure Regulator Valve Kit**

*Helps cure:*

- Delayed engagements, Soft shifts
- High line pressure in reverse

**Note:** Requires tool kit F-56947J-TL39 & the VB-FIX reaming fixture.

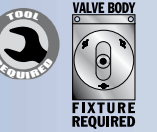


**6 56947J-56K**  
**Oversized Forward Engagement Valve Kit**

*Helps cure:*

- Slipping or loss of forward gears
- Burned forward clutch

**Note:** Requires tool kit F-27741-TL13 & the VB-FIX reaming fixture.

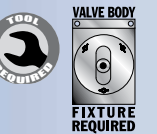


**7 56947J-49K**  
**Oversized PCA/PCB Modulator Valve Kit**

Fits either of 2 locations.

*Helps cure:*

- Line pressure concerns
- Delayed engagements in forward/reverse

**Note:** Requires tool kit F-56947J-TL49 & the VB-FIX reaming fixture.

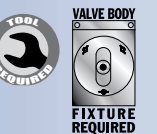


**8 56947J-53K**  
**Oversized Reverse Modulator Valve Kit**

*Helps cure:*

- Delayed reverse engagement
- Loss of 4th or 5th gear

**Note:** Requires tool kit F-56947J-TL53 & the VB-FIX reaming fixture.

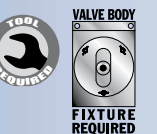

**9 56947J-59K**  
**Oversized Reverse Engagement Valve Kit**

*Helps cure:*

- Delay or loss of reverse
- Burned direct clutch

**Note:** Requires tool kit F-27741-TL13 & the VB-FIX reaming fixture.



Click on Sonnax part numbers to see more information.